

TRAIL CLOSURE NOTES:

1. SITE ACCESS SHALL BE MAINTAINED AT ALL TIMES DURING CONSTRUCTION.

2. TRAILS SHALL ONLY BE CLOSED DURING ACTIVE WORK.
AFTER WORKING HOURS, ALL OPEN EXCAVATIONS SHALL BE PROPERLY FENCED OFF.

3. TRAILS SHALL ONLY REMAIN CLOSED DURING OFF HOURS IF THERE IS AN OPEN EXCAVATION WITHIN THE TRAIL.

TRAIL BARRICADE


WALKWAY SURFACE

R9-9 24"x12"

34" MIN.

2" MAX. —

MATCH LINE - THIS SHEET

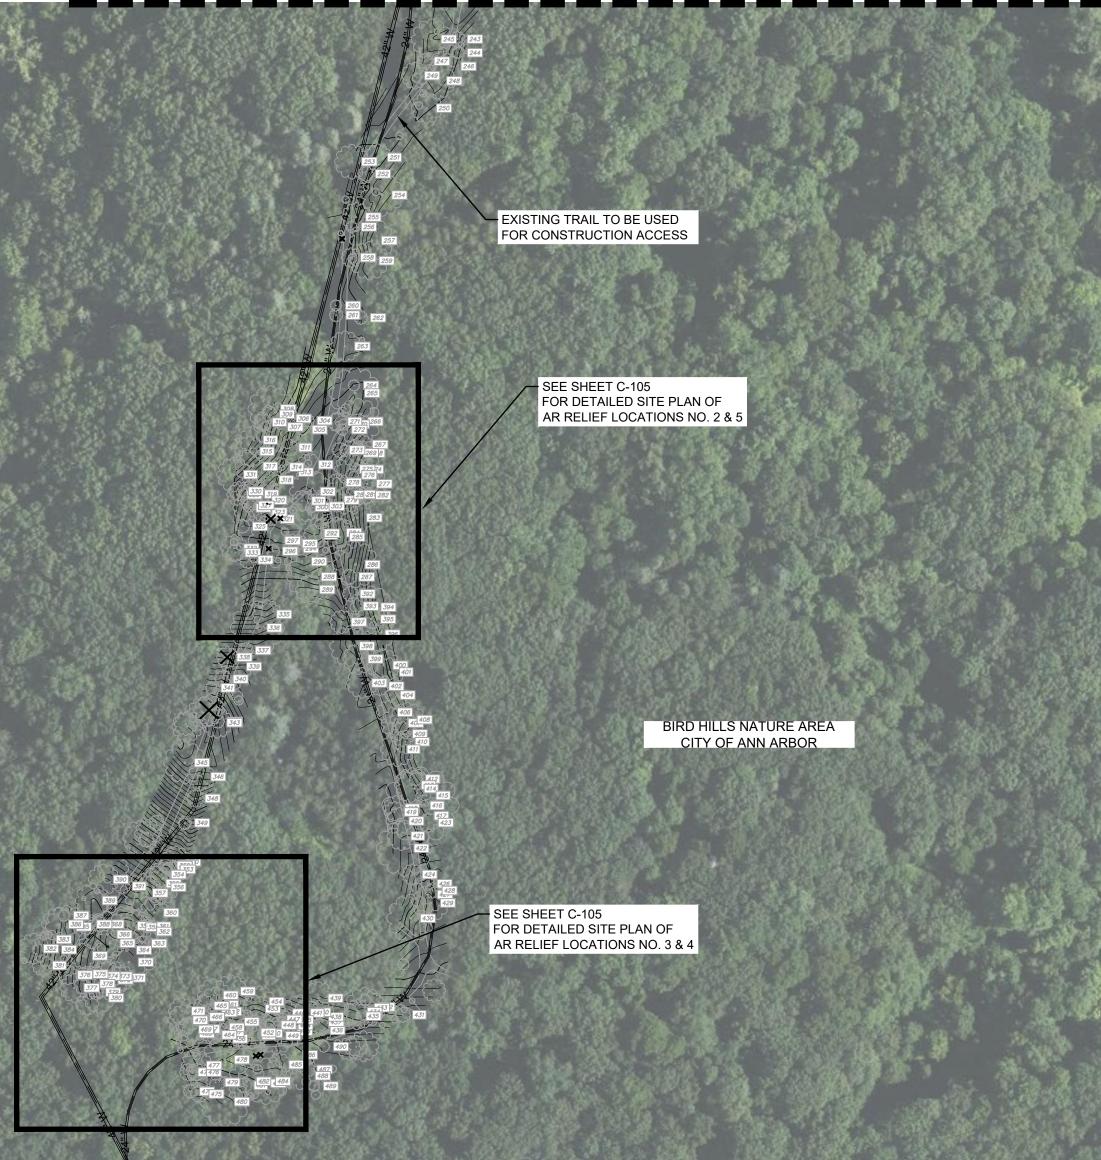

MATCH LINE - THIS SHEET

EXISTING TRAIL TO BE USED FOR CONSTRUCTION ACCESS

SEE SHEET C-105 FOR DETAILED SITE PLAN OF AR RELIEF LOCATIONS NO. 1 & 6

SEE SHEET C-105 FOR DETAILED SITE PLAN OF BIRD HILLS

ENTRANCE

EXISTING 24" WATERMAIN

EXISTING 42" WATERMAIN

BIRD HILLS ENTRANCE

BIRD HILLS NATURE AREA CITY OF ANN ARBOR

EXISTING TRAIL

EXISTING TREE REMOVAL (TYP.) -SEE TREE REMOVAL LIST BELOW

TREE REMOVAL LIST

BARTON PUMP STATION SITE

		DBH				Bat Habitat	
Common Name	Scientific Name	(inches)	Tree Tag #	Tree Status	Condition	(Y/N)	Comments
Slippery elm	Ulmus rubra	4	N/A	Live	Good	N	
American elm	Ulmus americana	5	N/A	Live	Good	N	
White oak	Quercus alba	5	N/A	Live	Good	N	
Slippery elm	Ulmus rubra	5	N/A	Dead	Poor	N	
Eastern cottonwoo	Populus deltoides	11	199	Dead	Poor	Υ	exfoliating bark
Black walnut	Juglans nigra	8,15	239	Live	Moderate	Υ	exfoliating bark
Slippery elm	Ulmus rubra	5	N/A	Live	Moderate	N	
Slippery elm	Ulmus rubra	4	N/A	Live	Good	N	
Slippery elm	Ulmus rubra	4	N/A	Live	Moderate	N	
Sugar maple	Acer saccharum	7	321	Live	Good	N	
Sugar maple	Acer saccharum	11	338	Live	Good	N	
Sugar maple	Acer saccharum	5	N/A	Live	Good	N	
Slippery elm	Ulmus rubra	4	N/A	Live	Good	N	
Slippery elm	Ulmus rubra	3	N/A	Live	Good	N	_

- 1. PRIOR TO PERFORMING TREE REMOVALS, CONTRACTOR SHALL PERFORM A FINAL WALK-THROUGH WITH THE ENGINEER AND CITY OF ANN ARBOR PARKS. TREES SHALL ONLY BE REMOVED AFTER THE WALK-THROUGH.
- 2. TREES SHALL BE CUT AND WOOD SHALL BE REMOVED OR PLACED AT THE DIRECTION OF THE CITY OF ANN ARBOR NATURAL AREA PRESERVATION. STUMPS SHALL BE REMOVED AND DISPOSED.
- 3. CONTRACTOR IS RESPONSIBLE FOR REMOVING OR RELOCATING DOWN TREES ALONG THE EQUIPMENT ACCESS ROUTES.



Stantec Consulting Michigan Inc. 3754 Ranchero Drive Ann Arbor MI 48108-2771 Tel: (734) 761-1010

Copyright Reserved

www.stantec.com

The Contractor shall verify and be responsible for all dimensions. DO NOT scale the drawing - any errors or omissions shall be reported to Stantec without delay. The Copyrights to all designs and drawings are the property of Stantec. Reproduction or use for any purpose other than that authorized by Stantec is forbidden.

Consultant

Revision		Ву	Appd	YYYY.MM.DD
D ADDENDUM #1 A C BID SET B PERMIT SET		CJE CJE CJE	KDJ KDJ	2022.01.10 2021.12.08 2021.11.30
A EGLE DRAFT REVIEW ISSUED		CJE By	KDJ Appd	2021.10.29 YYYY.MM.DD
File Name: 151509_C105	Dwn.	Dsgn.	Chkd.	2021.09.22 YYYY.MM.DD
Permit/Seal				

Client/Project Logo

Client/Project CITY OF ANN ARBOR BARTON PUMP STATION VALVE IMPROVEMENT PROJECT

DWSRF PROJECT NO. 7569-01

BIRD HILLS SITE ACCESS AND STAGING PLAN

Project No. 2075151509 Revision Sheet

ORIGINAL SHEET - ARCH D